

#### **VEHICLE**

4/2024

2025 TOYO Camry LE 4D SED 4-2.5L Hybrid Port/Direct Injection

VIN: 4T1DAACK6SU500303

Interior Color:

Mileage In:

Vehicle Out:

3P-117G License:

Exterior Color:

Mileage Out:

WY State:

Production Date:

Condition:

Job #:

TRANSMISSION

Automatic Transmission

**POWER** 

Power Steering Power Brakes

Power Windows

Power Locks

Power Mirrors

**Heated Mirrors** 

**DECOR** 

**Dual Mirrors** Tinted Glass

Console/Storage

Overhead Console CONVENIENCE

Air Conditioning

Intermittent Wipers

Tilt Wheel

Cruise Control Rear Defogger

Keyless Entry

Alarm

Message Center

Steering Wheel Touch Controls

Telescopic Wheel Climate Control Backup Camera

Intelligent Cruise RADIO

AM Radio

FM Radio

Stereo Search/Seek

Auxiliary Audio Connection

Satellite Radio

SAFETY

Drivers Side Air Bag Passenger Air Bag Anti-Lock Brakes (4)

4 Wheel Disc Brakes

Front Side Impact Air Bags Head/Curtain Air Bags Hands Free Device

Rear Side Impact Air Bags Blind Spot Detection

Lane Departure Warning

SEATS

Cloth Seats **Bucket Seats** 

WHEELS

Aluminum/Alloy Wheels

PAINT

Clear Coat Paint

OTHER

Traction Control Stability Control

Signal Integrated Mirrors Xenon or L.E.D. Headlamps

California Emissions

### **Preliminary Estimate**

# Customer:

Job Number:

2025 TOYO Camry LE 4D SED 4-2.5L Hybrid Port/Direct Injection


Line		Oper	Description	Part Number	Qty	Labor	Paint
1	FRONT BUMPE	R & G	RILLE				
2		Repl	Prep unprimed bumper		1		0.
3			O/H bumper assy			3.6	
4		Repl	Bumper cover w/o front park aid	52119AQ900	1	Incl.	3.
5			Add for Clear Coat				1.
6		Repl	Bumper cover clip	9046705170	2		
7		Repl	Bumper cover retainer	5387902150	4		
8		Repl	Bumper cover pin	4774902020	4		
9		Repl	Bumper cover grommet	9018906237	2		
10		Repl	LT Side retainer	52536AQ010	1	0.1	
11		R&I	License bracket			0.2	
12		R&I	Grille assy LE			Incl.	
13		Repl	Emblem	90975A2024	1	Incl.	
14	FRONT LAMPS						
15		Repl	LT Headlamp assy	81150AQ010	1	0.3	
16			Aim headlamps			0.5	
17	HOOD						
18	*	Rpr	Hood (ALU)			<u>5.0</u> 1	3.
19			Add for Clear Coat				1.
20	FENDER						8
21		Repl	LT Fender	53802AQ010	1	1.9	2.
22			Overlap Major Adj. Panel				-0.
23			Add for Clear Coat				0.
24			Add for Edging			2000	0.
25		R&I	LT Fender liner		8	Ind.	
26		Repl	LT Fender liner grommet	9018906236	4		
27		Repl	LT Fender liner clip	9046707214	11		
28	ELECTRICAL						
29		R&I	Antenna w/o panoramic roof			 0.3	
30	WINDSHIELD				10		
31		Repl	Windshield Toyota, w/o head-up display	56101AQ010	1	3.3	
32		Repl	LT Side molding clip	755450E020	12		
33			LT Side molding rivet	7554751021	12		
34	ROOF		•				
35	*	Rpr	Roof panel			1.0	2
36		- 8	Overlap Major Non-Adj. Panel				-0
37			Add for Clear Coat				0
38		R&I	RT Drip molding			0.5	
39		Repl	LT Drip molding	7555606090	1	0.5	
40		Repl	LT Drip molding clip	7556108040	4		
41		R&I				3.3	
42	PILLARS, ROC						

# **Preliminary Estimate**

100 AND 11	77900 1100 PAGE 1000	toenes a	15. SUPAR MUNACH SUM GREET IN 1899			Job Nu	mbe
25 T	OYO Camry LE 4D	SED 4-	2.5L Hybrid Port/Direct Injection				
43		R&I	LT Rocker molding LE, XLE			0.9	
44		Repl	LT Rocker molding clip #1	75867AA010	9		
15		Repl	LT Rocker molding clip #2	9046722015	4		
16		Repl	LT Rocker molding retainer	9046722014	4		
17		Repl	LT Rocker molding grommet #1	9018906157	2		
18		Repl	LT Rocker molding grommet #2	9018906237	1		
19		Repl	LT Rocker molding grommet #3	90189A0007	2		
50		R&I	RT Wndshld plr trim w/o JBL audio black			0.2	
51		R&I	LT Wndshld plr trim w/o JBL audio black			0.2	
52		Repl	RT Wndshld plr trim clip	90467A0006	2		
53		Repl	RT Wndshld plr trim retainer	6221706030	2		
4		R&I	RT Upr ctr plr trim black			0.5	
55		R&I	LT Upr ctr plr trim black			0.5	
56		Repl	LT Upr ctr plr trim clip	9046710167	2		
7		Repl	LT Upr ctr plr trim retainer	90467A0051	4		
8	FRONT DOOR						
9	*	Rpr	LT Outer panel (HSS)			5.0	
0			Overlap Major Adj. Panel				-
1			Add for Clear Coat				
2		Repl	LT Belt molding black	75720AQ010	1	0.3	
3		Repl	LT Mirror assy w/surround view w/o park assist	87940AQ020	1	0.4	
			Note: MURAKAMI				
4		Repl	LT Mirror cover silver	8794506130B1	1	Incl.	
5			Overlap Minor Panel				-
66			Add for Clear Coat				
57		Repl	LT Door glass Toyota w/acoustic	68102AQ010	1	0.6	
8		R&I	LT Run w'strip			0.2	
9		R&I	LT Handle, outside w/o smart key silver			0.4	
70		R&I	LT R&I trim panel			0.6	
1	REAR DOOR						
2	*	Blnd	LT Outer panel (HSS)	2009 Marie (1230) 1934 (1230)	1.20		
3		Repl	LT Belt molding black	75740AQ020	1	0.3	
4		R&I	LT Moveable glass Toyota			0.6	
75		R&I	LT Run w'strip			0.3	
76		R&I	LT Handle, outside silver			0.4	
7		R&I	LT R&I trim panel			0.5	
'8	VEHICLE DIAG						
79	*	Rpr	Pre-repair scan			0.5 M	
30	*	Rpr	Post-repair scan		LW	<u>0.5</u> M	
31	#	Subl	HAZARDOUS WASTE DISPOSAL		1	2.2	
32	#	Repl	CAR COVER / MASK FOR OVERSPRAY		1	0.3	
			VERSITIAT				
				100000000000000000000000000000000000000			200

#### **Preliminary Estimate**

DE TO	2VO C	LE AD CED A	1. Undersid Deut/Dissert Infortion		Job N	Job Number:	
25 10	OYU Camry	LE 4D SED 4-	2.5L Hybrid Port/Direct Injection				
83	#		TINT COLOR TO MATCH	1		0.	
84	#	Repl	RESTORE CORROSION PROTECTION	1	0.2		
85	#	Repl	FLEX ADDITIVE	1			
86	#	Repl	URETHANE KIT	1			
87	#		CLEAN UP BROKEN GLASS	1	1.0		
			SUBTOTAL	.s	34.9	18.4	

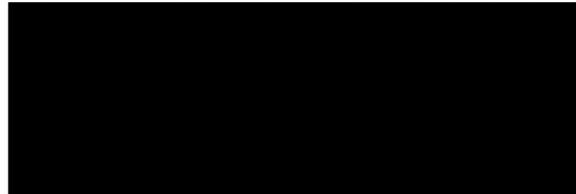

OUR SERVICE IS GUARANTEED AS LONG AS YOU OWN YOUR VEHICLE. RENO COLLISION CENTER'S GOAL IS TO PROVIDE YOU WITH THE BEST POSSIBLE SERVICE AND MAINTAIN YOUR VALUED CONFIDENCE. YOUR PATRONAGE TO OUR BUSINESS IS GREATLY APPRECIATED, THANK YOU!

THIS ESTIMATE MAY BE BASED IN WHOLE OR IN PART UPON THE PAINTLESS DENT REPAIR METHOD. EACH ITEM OF DAMAGE ADJUSTED USING THAT METHOD IS IDENTIFIED ON THE ESTIMATE. THE PAINTLESS DENT REPAIR METHOD MAY NOT BE THE APPROPRIATE REPAIR METHOD FOR ALL TYPES OF DAMAGE. IF AN INSURER IS LIABLE FOR THE DAMAGE LISTED ON THE ESTIMATE, THE INSURER SHALL PROVIDE SUFFICIENT COMPENSATION TO RESTORE THE VEHICLE TO SUBSTANTIALLY THE SAME PHYSICAL CONDITION. FOR ANY DAMAGE WHERE IT IS APPROPRIATE TO REPAIR THE VEHICLE USING THE PAINTLESS DENT REPAIR METHOD, THE INSURED MAY CHOOSE NOT TO REPAIR THE VEHICLE OR CHOOSE TO HAVE THE VEHICLE REPAIRED USING A DIFFERENT METHOD OF REPAIR. IF THE INSURED CHOOSES EITHER OF THESE OPTIONS, THE INSURER IS LIABLE ONLY FOR THE COST OF THE PAINTLESS DENT REPAIR METHOD.